



Technical Bulletin #1639

Transmission: 6R80

Subject: *Wrong Gear Starts, Possible P0720 and P0722 OSS Codes*

Application: *Ford/Lincoln*

Issue Date: *September, 2014*

6R80

Wrong Gear Starts, Possible P0720 and P0722 OSS Codes

The following information pertains to these vehicles: 2011-2014 Mustang, 2011-2013 F150, 2012-2013 Expedition and 2012-2013 navigator with 6R80 transmission built before 4/8/2013.

The transmission may start off in 5th gear and possible codes of P0720 and P0722 for the output speed sensor. Also the speedometer reads zero and odometer may display dashes while driving. The wrench light may be on, along with seat belt warning light.

Ford has issued a TSB 13-6-8 for these conditions and wants you to update the molded lead frame on the valve body. The updated part number at this time is AL3Z-7G276-A but we always recommend you to check for updated part numbers.

