




Technical Bulletin #1610

Transmission: 41TE/42LE/42RLE
Subject: Check Ball Locations
Application: Chrysler
Issue Date: May, 2014

41TE/42LE/42RLE Check Ball Locations

Check Ball #2 Was Eliminated in 2009 on the 41TE and 42RLE
(No Hole in that Location)

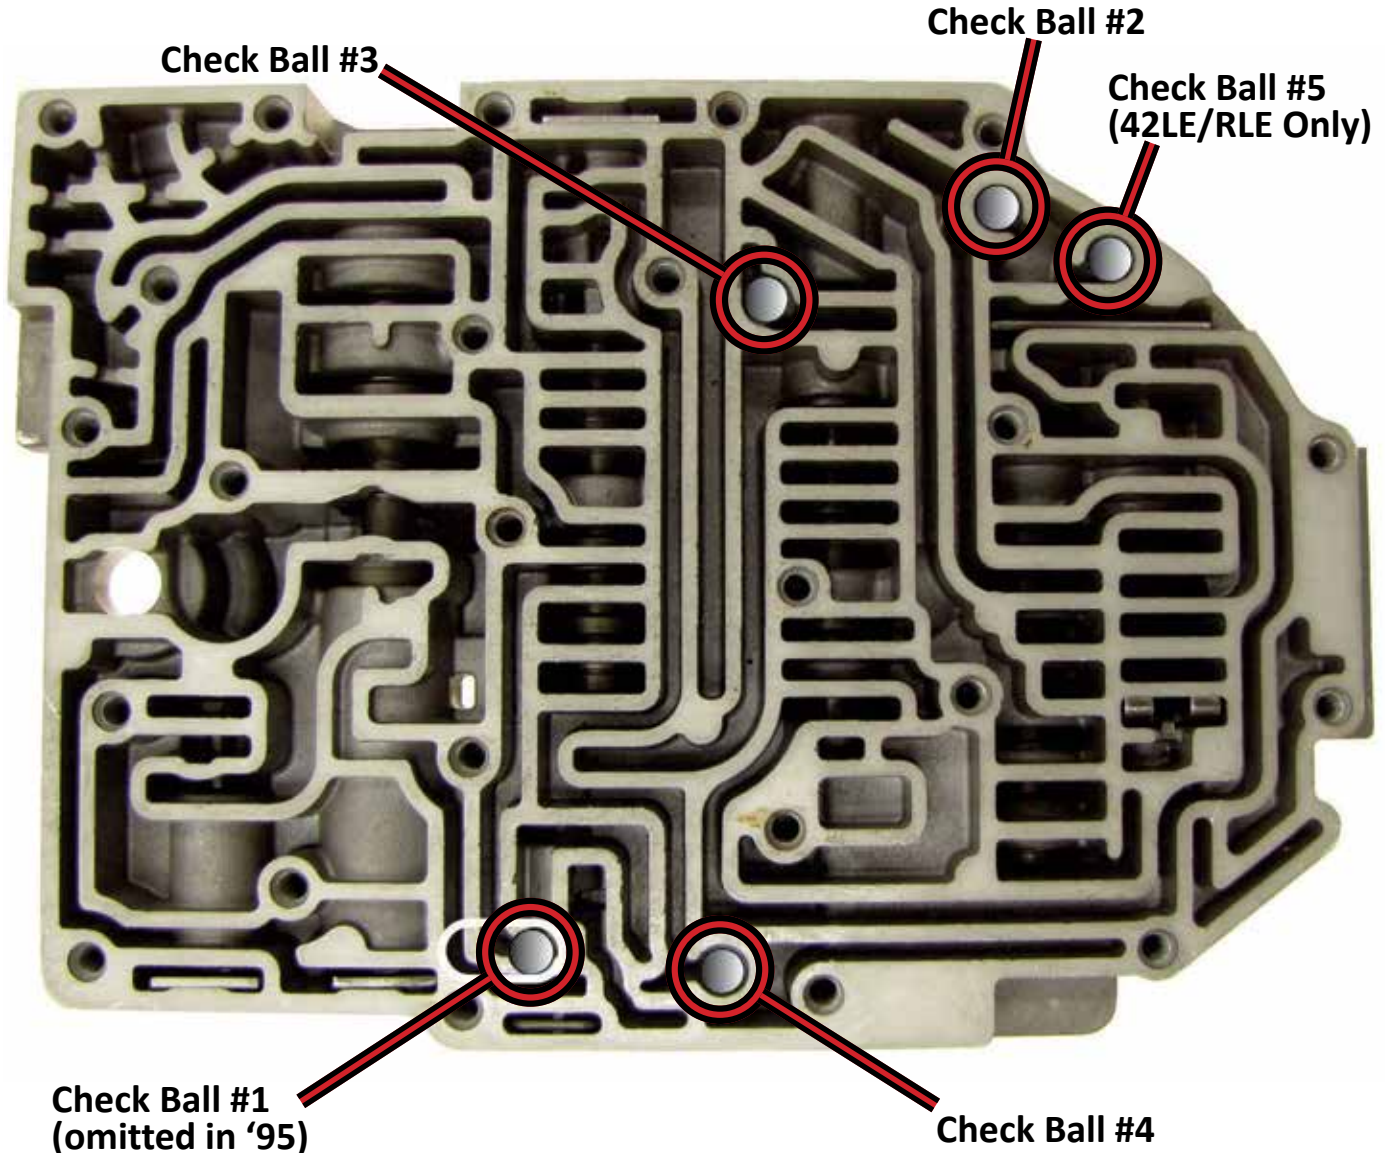

Late Valve Body Shown
(Earlier 41TE/42LE Valve Body has a #1 Check Ball Located in Bathtub)

41TE/42LE/42RLE Check Ball Locations

#1610

Check Ball #5 Capsule (41TE)

Note: The capsule
changed to a 1/4"
check ball in 2007 with
variable line pressure
control.

Channel Plate (Early Models)

Deleted in
2009

Thermal Valve

- #1 L/R Shuttle
- #2 U/D Feed & Bypass
- #3 L/R Circuit
- #4 Reverse Orifice
- #5 O/D Exhaust

